

Manhole Inspection Summary

Manhole # S0700_001MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **0700** Node: **001** Status: **Found**

Insp Date: **4/11/08 4:19 PM**

Incomplete Comments

Crew: **BC JD**
Inspector: **Chung**
Firm: **URS**

Location Address: **2400 MONDAWMIN AVE**

Cross Street: **ROSLYN AVE**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **8** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Precast Concrete**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Precast Concrete**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps

Count: **4** Missing: **0** ☐ Corroded


Surcharge

☒ **Evidence Of Surcharge** Depth: **3** (ft.) ☐ Active Surcharge Present

Location View




GRADE ADJUSTMENT

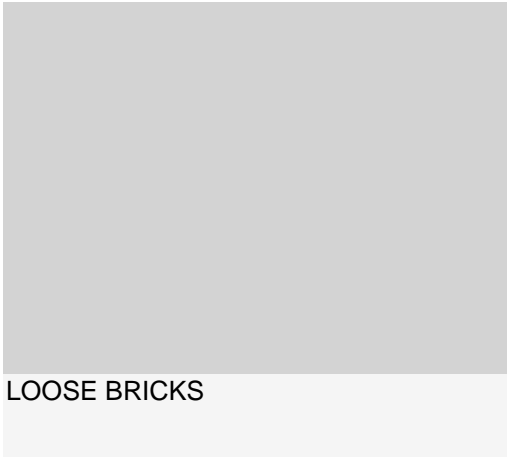

LOOSE BRICKS

Top View



DEBRIS ON BENCH AND IN CHANNEL,
EVIDENCE OF 3' SURCHARGE ON
BARREL WALLS

Defect 2



BENCH DEBRIS

Manhole Inspection Summary


Manhole # S07OO_001MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



2" SLUDGE AND DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **12.30** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☒ **Debris** ☐ Grease

Silt Depth: **2** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



2" GREASE AND DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **11.90** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☒ **Grease**

Silt Depth: **2** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S07OO_001MH

Printed On: 6/24/2010

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe In @ 9 O'Clock

9 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)
Pipe Material: **PVC** ☐ Pipe Lined
Invert Depth: **12.10** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**
☐ Possible Illicit Connection